

ECS Configuration Change Request

Page 1 of 3 Page(s)

1. Originator Randy Haynes	2. Log Date: 11/20/98	3. CCR #: 98-1212	4. Rev: —	5. Tel: 925-0932	6. Off: 2110F	7. Org. SED
8. Title of Change: Change to the Ingest Hosts' Static Route Configuring Script						
9. Originator Signature <i>Randy Haynes</i>	10. Date: 11/18/98	11. Class II	12. Type: CCR	13. Need Date: 12/4/98		
14. Office Manager Signature <i>Randy Hollings</i>	15. Date: 11/19/98	14. Date CCB Decision Needed: n/a	17. Category of Change: Other	18. Priority: Routine		
19. Documentation/Drawings Impacted: N/A		20. Schedule Impact: none		21. CI(s) Affected:		
22. Release Affected: REL2		23. Date due to Customer: n/a	24. Impl. Date: 12/4/98	25. Effectivity of Change: n/a	26. Est. Cost: None	
27. Source Reference: <input checked="" type="checkbox"/> NCR (attach) <input type="checkbox"/> Action Item <input type="checkbox"/> GSFC CCR <input type="checkbox"/> Tech Ref. <input type="checkbox"/> Other: 18344						
28. Description of Change: (use additional Sheets if necessary) Recent DAAC SGI operating system patches have introduced disruption of the operating system boot process for the Ingest hosts at EDC. The referenced NCR indicates that the systems hang at boot time at EDC. SGI has recommended that the "static route" statements currently in startup script file /etc/init.d/network.local be moved to startup script file /etc/config/static-route.options. EDC implemented this change and demonstrated that the boot problem was fixed. Non-Ingest SGI hosts do not exhibit this boot problem because their network initialization script for static routes is not in the /etc/init.d/network.local file.						
29. Proposed Solution: (use additional sheets if necessary) For the three Ingest hosts at EDC, LaRC, and GSFC, implement SGI's recommendation. DAAC M&O staff are to make the modifications according to the Engineering Technical Directive (see attached).						
30. Alternate Solution: (use additional sheets if necessary) none						
31. Consequences if Change(s) are not approved: (use additional sheets if necessary) EDC's Ingest hosts will not reboot. LaRC and GSFC are at risk of having similar problems.						
32. Does Change Affect Any of the following (Please Explain on additional sheet): <input type="checkbox"/> Maintenance Training <input type="checkbox"/> Performance <input type="checkbox"/> Operation Training <input type="checkbox"/> Safety <input type="checkbox"/> Service <input type="checkbox"/> Support <input type="checkbox"/> Test <input type="checkbox"/> Baseline (XRP) <input type="checkbox"/> Y2K Compliance						
33. Organization(s) Affected: <input type="checkbox"/> CM <input type="checkbox"/> Clearcase SG <input type="checkbox"/> Contracts <input type="checkbox"/> Chief Eng <input type="checkbox"/> FOS <input checked="" type="checkbox"/> M&O <input type="checkbox"/> QO <input type="checkbox"/> Rel Dev <input type="checkbox"/> Procurement <input type="checkbox"/> RTSC <input type="checkbox"/> Sci. Data Eng <input type="checkbox"/> Security <input type="checkbox"/> Sys. Dev. <input checked="" type="checkbox"/> Sys. Eng. <input type="checkbox"/> Sys Verif Acpt <input type="checkbox"/> Other						
34. Site(s) Affected: <input type="checkbox"/> EDF <input type="checkbox"/> Mini-DAAC <input type="checkbox"/> VATC <input checked="" type="checkbox"/> EDC <input checked="" type="checkbox"/> GSFC <input checked="" type="checkbox"/> LaRC <input type="checkbox"/> NSIDC <input type="checkbox"/> SMC <input type="checkbox"/> AK <input type="checkbox"/> JPL <input type="checkbox"/> EOC <input type="checkbox"/> Other						
35. Board Comments:				36. Work Assigned To:		
37. Release Authorized (For CM Use Only): <input type="checkbox"/> Yes <input type="checkbox"/> No				38. CM Verified/Signature and Date		
39. EDF/REL2 CCB Chair (Sign/Date): <i>[Signature]</i> 11/23/98		40. Disposition: <input checked="" type="checkbox"/> App <input type="checkbox"/> Ap/C <input type="checkbox"/> DisApproved <input type="checkbox"/> Withdraw <input type="checkbox"/> Fwd/ECS <input type="checkbox"/> Fwd/ESDIS		41. ESDIS ERB Concurrence:		
42. ECS OCB Chair (Sign/Date):		43. Disposition: <input type="checkbox"/> App <input type="checkbox"/> A/C <input type="checkbox"/> DisApproved <input type="checkbox"/> Withdraw		44. CCR Closed Date:		

ORIGINAL

②

18 November 1998

Subject: Change to the Ingest Hosts' Static Route Configuring Script

The following directive is issued to GSFC, EDC, and LaRC DAACs.

Issue: The operating system boot process was changed by recent SGI patches, affecting the startup sequence of Ingest hosts by causing a system hang during the boot process. This technical directive provides the information necessary to avoid the boot hang by changing the location of the network static route definition scripts to the location recommended by SGI.

Fix:

1.0 General

This technical directive describes the modification needed on all SGI Ingest hosts. This modification may be done during normal system operation. Non-Ingest SGI hosts are not affected.

The static route statements currently existing in file `/etc/init.d/network.local` are to be commented out and then duplicated into file `/etc/config/static-route.options`.

2.0 Procedure Details

Execute the following steps for each Ingest host:

1. Login as root.
2. For each static route statement in file `/etc/init.d/network.local`, place a duplicate statement in file `/etc/config/static-route.options`. For example,
 `route add default 198.118.204.65`
 `route add net 198.118.202.0 198.118.204.66`
3. In file `/etc/init.d/network.local`, place a pound sign (#) in column one of every "route add ..." line duplicated in step 1.

Testing:

For each host, reboot the host and verify that the static route statements are according to baseline document 921-TDx-005. The routes may be listed by executing "netstat -rn" command

Implementation:

All Ingest hosts at GSFC, EDC, and LaRC DAACs as follows:

GSFC:

- g0icg01
- g0icg02
- g0icg03
- gvicgaa

EDC:

- e0icg01
- e0icg02
- e0icg03

LaRC:

- l0icg01
- l0icg02
- l0icg03

ORIGINAL



ECS Project

Engineering Technical Directive

No. 98-006

18 November 1998

Approved By: Joe Guzek
Chief Engineer

Joe Guzek 11/23/98

Reference CCR: 98-1212

Technical Contact: Randy Haynes
(301) 925-0932
rhaynes@eos.hitc.com

-----End of Directive-----

ORIGINAL